

Report No.: 2018032918272788

Report Date:17 September 2018

Page 1 of 42

GENERAL INFORMA	TION	
Inspection Type	Normal inspection	
Buyer Name		
Vendor Name		
P.O. Number		
Item Number	170715/170716/ AMS118-1/ AMS108/ AMS109	
Product Name	Hair Brush	
Service Performed	FRI	
Inspection Date	Sep. 17. 2018	2014/19/17
Inspection Location	Ningbo, Zhejiang	
Ref. sample(s) Available	No	

INSPECTION RESULTS						
OVERALL CONCLUSION Not Conform						
INSPECTION SUMMARY	CONCLUSIONS	REMARKS				
A. Visual And Workmanship		Defects	CRI	MAJ	MIN	
		Sample Size	500	500	500	
	Not Conform	AQL	N/A	N/A	N/A	
		Max	N/A	N/A	N/A	
		Found	0	217	51	
B. Quantity Conformity	Pending	Remark 1, 2				
C. Product Conformity	Conform					
D. Packing / Marking / Labeling	Pending	Remark 3				
E. Data Measurement / Field Test	Not Conform	Remark 4, 5				
F. Special Attention	Conform					
G. EU Safety requirements	Conform					

RE	MARKS
1	Actual shipping quantity was 20400pcs instead of 20000pcs.
2	98.24% of the total quantity was finished and packed.
3	Actual found shipping mark different with spec, detail see below pictures.



Report No.: 2018032918272788

Report Date:17 September 2018

Page 2 of 42


Shipping mar	k Importer: N° OF Ode Reference: Qty / Carton: N° OF Carton:	
NOM CLIENT  Numéro de commande: 2179 ITEM#: 1707* DESCRIPTION: HAIF MADE IN: CHIP	15 R Brush abs 25.5*9cm design wake up and make up	Numéro de commande: 217939 ITEM#: 170715 G.W.: 10.8 kgs N.W.: 9.8 kgs QTY.: 120PCS/CTN CTY NO.: 24 OF 34
NOM CLIENT  Numéro de commande: 21793 ITEM#: 170716 DESCRIPTION: HAIRI MADE IN: CHINA Supplier	BRUSH ABS 25.5°9CM DESIGN PALMIER	Numéro de commande: 217939 ITEM#: 170716 G.W.: 10.8 kgs N.W.: 9.8 kgs QTY.: 120PCS/CTN CTY NO.:   ) OF 34



Report No.: 2018032918272788

Report Date:17 September 2018

Page 3 of 42

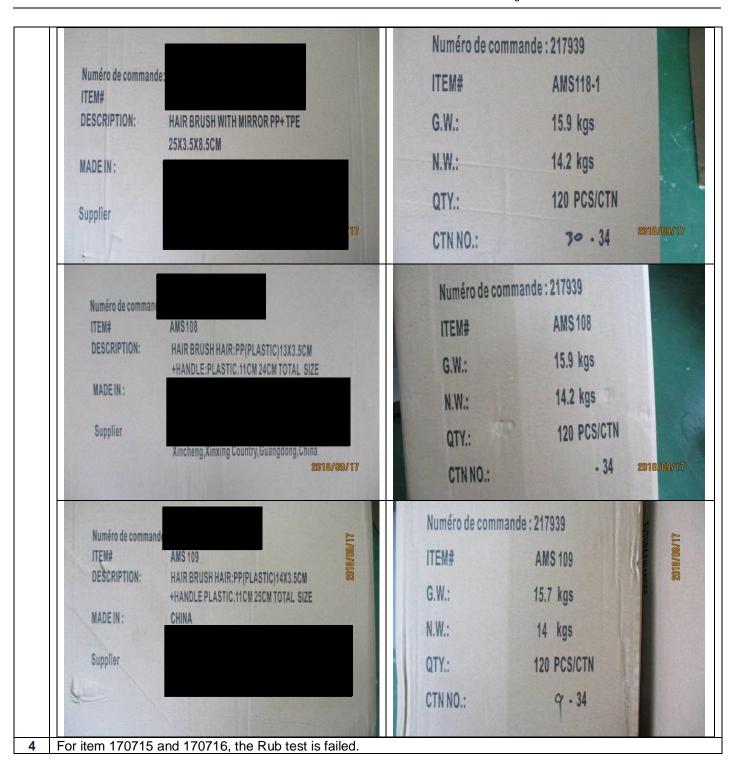



Report No.: 2018032918272788

Report Date:17 September 2018

Page 4 of 42





5 For item AMS118-1 and AMS108, the factory refused to do the carton drop and Individual drop test

6 For item 170715 and 170716, the top surface is rough, see below picture.





For item 170715 and 170716, the glue between two materials are inoperative, you can easily separate from each other. See below picture.





For item AMS109, there are mould marks on product surface. See below picture.



Report No.: 2018032918272788

Report Date:17 September 2018

Page 5 of 42





A. Visual and Workmanship								
Inspection Standard		ANSI/ASQ Z1.4 Single Sa	ampling Plan					
Inspection Level		N/A						
Defect Classification	Critical	Major	Minor					
AQL	N/A	N/A		N/A				
Sample Size	500	500		500				
Max Allowed	N/A	N/A		N/A				
Total Found	0	217 51						
Details of Defect Found: Style #170715 – 100% Defectives Critical Major				Minor				





Poor assemble - Major

100

0

The results reflects our findings at time and place of inspection. This report does not relieve seller/manufacturers from their contractual liabilities or prejudice buyers' right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment, Final approval is required by client before releasing shipment.



Report No.: 2018032918272788

Report Date:17 September 2018

Page 6 of 42





Report No.: 2018032918272788

Report Date:17 September 2018

Page 7 of 42





Poor assemble – Major	Poor assemble – Major			
Details of Defect Found: Style # AMS118-1 - 25%	6 Defectives	Critical	Major	Minor
Hole		0	1	0
Poor assemble		0	5	0
Poor mirror		0	1	2
Dirty mark		0	0	3
Flash mark		0	0	3
Glue mark		0	0	5
Scratches mark		0	0	1
Poor finishing	_	0	0	1





Hole - Major

Poor assemble – Major



Report No.: 2018032918272788

Report Date:17 September 2018

Page 8 of 42





Report No.: 2018032918272788
Report Date:17 September 2018

Page 9 of 42





Report No.: 2018032918272788
Report Date:17 September 2018

Page 10 of 42





Report No.: 2018032918272788
Report Date:17 September 2018

Page 11 of 42





Report No.: 2018032918272788

Report Date:17 September 2018

Page 12 of 42

Details of Defect Found: Style # AMS108 – 19% Defectives	Critical	Major	Minor
Poor mirror	0	2	1
Poor assemble	0	1	0
Poor painting	0	1	4
Rough edge /Rough surface	0	0	3
Scratches mark	0	0	2
Flash mark	0	0	2
Glue mark	0	0	1
Poor finishing	0	0	2





Poor mirror – Major

Poor mirror – Major

Poor mirror – Minor





Report No.: 2018032918272788 Report Date:17 September 2018





Report No.: 2018032918272788
Report Date:17 September 2018

Page 14 of 42





Report No.: 2018032918272788

Report Date:17 September 2018

Page 15 of 42





Glue mark - Minor

Poor finishing - Minor



/

D	f::	1.4:
Poor	finishina	<ul><li>Minor</li></ul>

	- /

Details of Defect Found: Style # AMS109 – 24% Defectives	Critical	Major	Minor
Rough surface	0	3	4
Poor painting	0	3	0
Glue mark	0	0	1
Flash mark	0	0	1
Scratches mark	0	0	12



Report No.: 2018032918272788
Report Date:17 September 2018

Page 16 of 42





Report No.: 2018032918272788 Report Date:17 September 2018





Report No.: 2018032918272788 Report Date:17 September 2018





Report No.: 2018032918272788
Report Date:17 September 2018

Page 19 of 42





Report No.: 2018032918272788
Report Date:17 September 2018

Page 20 of 42

#### **B. Quantity Conformity**

Quantity Confor	mity				Per	nding
Item Number	P.O. No	Inspection	Presented Qty	/ for inspection	Number	of Cartons
		Qty	Packed	Not packed	Packed	Not packed
170715	1123 -	4080	4080	0	34	0
170716	0000217939	4080	4080	0	34	0
AMS118-1		4080	3720	360	31	3
AMS108		4080	4080	0	34	0
AMS109		4080	4080	0	34	0
Tot	tal	20400	20040	360	167	3
Remark: 1, 2						

#### C. Product Conformity





Report No.: 2018032918272788

Report Date:17 September 2018





Report No.: 2018032918272788
Report Date:17 September 2018

Page 22 of 42

Product view Product view 2018/09/17 Product view Product view Outer carton Inner carton 2018/09/17



Report No.: 2018032918272788

Report Date:17 September 2018

Page 23 of 42





Report No.: 2018032918272788

Report Date:17 September 2018

Page 24 of 42





Report No.: 2018032918272788

Report Date:17 September 2018

Page 25 of 42





Report No.: 2018032918272788

Report Date:17 September 2018

Page 26 of 42





Report No.: 2018032918272788

Report Date:17 September 2018

Page 27 of 42





Report No.: 2018032918272788

Report Date:17 September 2018

Page 28 of 42






Report No.: 2018032918272788


Report Date:17 September 2018

Page 29 of 42

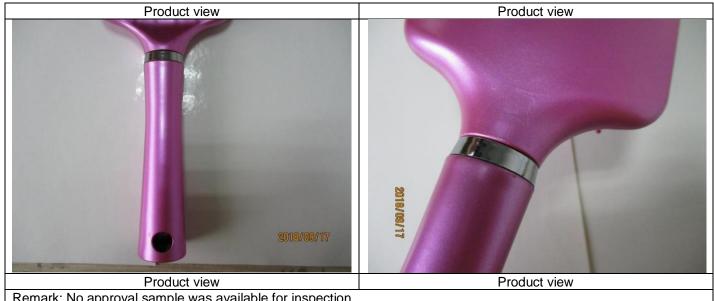

Remark: No approval sample was available for inspection.

#### D.Packing / Marking / Labeling

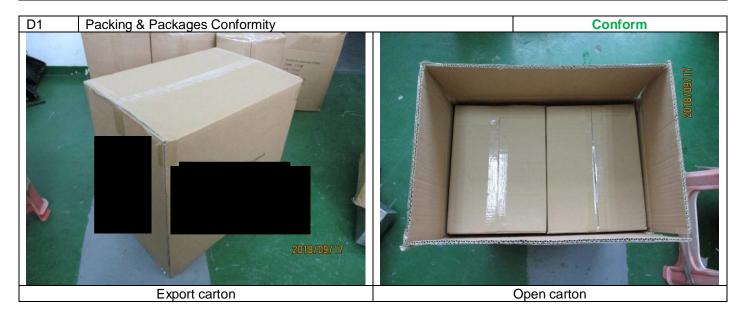



Report No.: 2018032918272788
Report Date:17 September 2018

Page 30 of 42






Report No.: 2018032918272788

Report Date:17 September 2018

Page 31 of 42

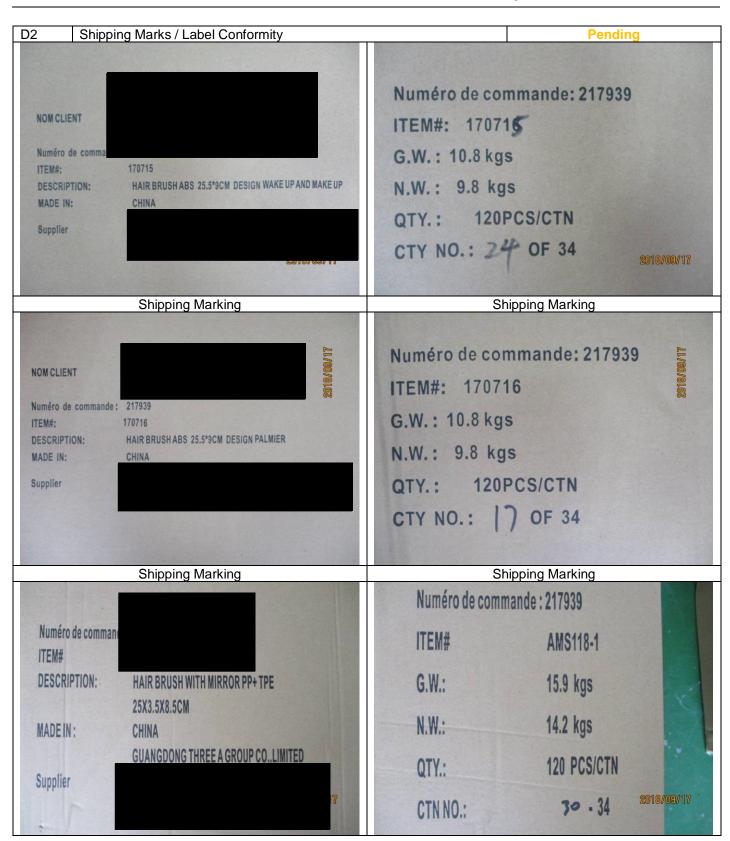




Report No.: 2018032918272788

Report Date:17 September 2018

D 00 (4)

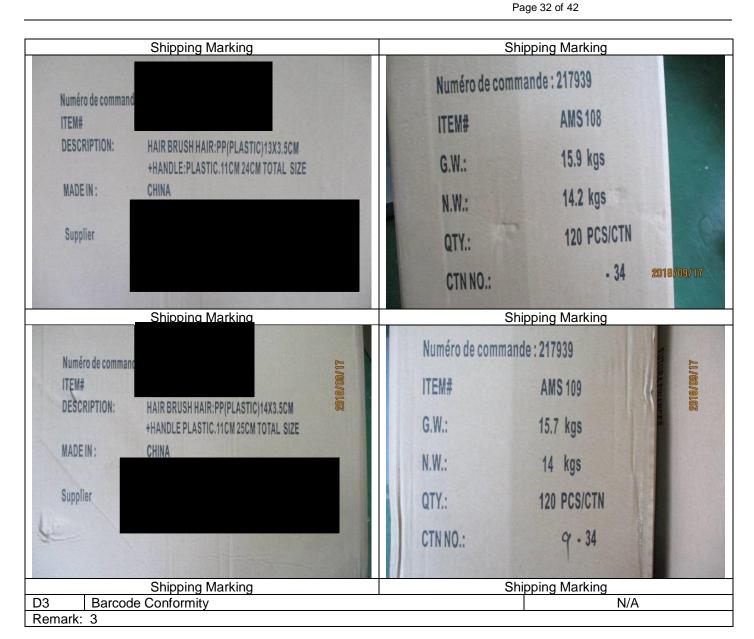

#### E. Data Measurement / Field Test

	Test Item	Test Requirement	Sample Size	Test Result
E1	Drop Test	Drop the package ten (10) times from 31 cm on a bare, hard (concrete) floor.	3 pcs	Conform



Report No.: 2018032918272788

Report Date:17 September 2018

Page 33 of 42






Report No.: 2018032918272788

Report Date:17 September 2018

Page 34 of 42

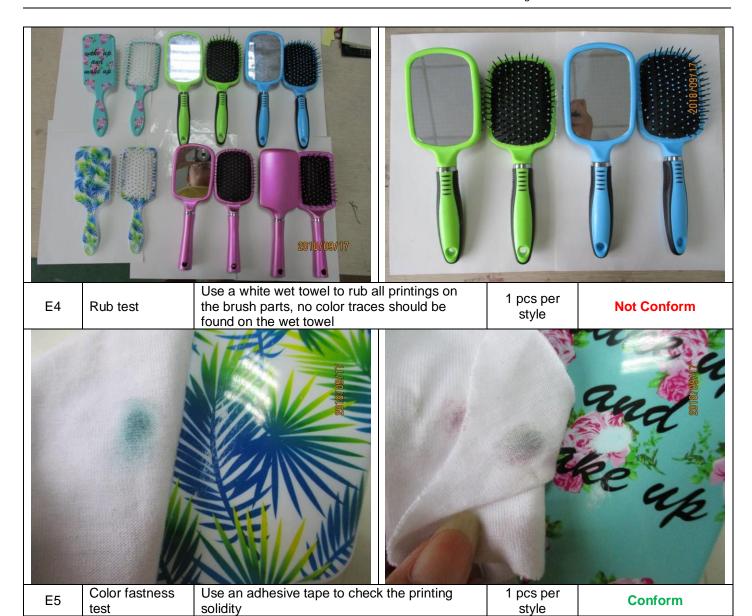



Report No.: 2018032918272788

Report Date:17 September 2018

Page 35 of 42






Report No.: 2018032918272788

Report Date:17 September 2018

Page 36 of 42

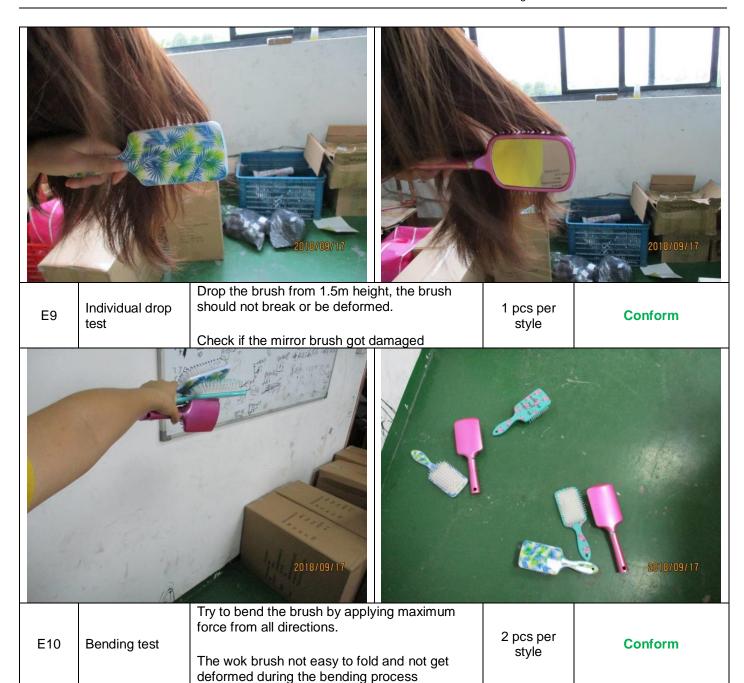



Report No.: 2018032918272788

Report Date:17 September 2018

Page 37 of 42





Report No.: 2018032918272788

Report Date:17 September 2018

Page 38 of 42





E13	E13 Dimension Check		As per client-provided specification						See below chart		
Measu	red Point	Item number	Unit 1	Unit 2	Unit 3	Item nu	ımber	Unit 1	Unit 2	Unit 3	
Length (cm)			21.7	21.7	21.7			21.7	21.7	21.7	
Width (cm)			7.0	7.0	7.0	170716	7.0	7.0	7.0		
Thickness		170715	4.0	4.0	4.0		4.0	4.0	4.0		
Teeth length (cm)			1.7	1.7	1.7			1.7	1.7	1.7	
Weight (g)			78.0	78.3	78.9			79.3	78.5	79.0	
Measured Point		Item number	Unit 1	Unit 2	Unit 3	Item number		Unit 1	Unit 2	Unit 3	
Length	(cm)		24.8	24.8	24.8		24.3	24.3	24.3		
Width (cm) Thickness		AMS118-1	8.2	8.2	8.2	AMS108	8.2	8.2	8.2		
			4.0	4.0	4.0		3.5	3.5	3.5		
Teeth length (cm)			1.7	1.7	1.7		1.7	1.7	1.7		
Weight	(g)		107.5	106.1	106.8	]		111.6	112.0	111.9	
Measured Point		Item number	Unit 1	Unit 2	Unit 3	Item nu	ımber	Unit 1	Unit 2	Unit 3	
Length	(cm)		25.0	25.0	25.0		/	/	/		
Width (cm)			8.0	8.0	8.0		/	/	/		
Thickne	ess	AMS109	4.0	4.0	4.0	/	/	/	/		
Teeth length (cm)			1.7	1.7	1.7		/	/	/		
Weight (g)			119.1	119.8	120.3		/	/	/		



Report No.: 2018032918272788

Report Date:17 September 2018

Page 39 of 42





Measure check Measure check

E12 Barcode Scan Must be able to scan and barcodes are correct as printed 6 Pcs Pending No barcode

Remark: 4,5

#### **F.Special Attention**

F1 /

#### **G.** Information



Item No.:	Size (cm)
170715	47x34x49
170716	47x34x49
AMS118-1	48.5x27.5x66.5
AMS108	48x27x66.5
AMS109	47x28x66

Finding: See below

Carton measurement check Carton measurement check

G2 Gross weight of carton Finding: See below



Report No.: 2018032918272788

Report Date:17 September 2018

Page 40 of 42



Item No.:	Weight (kg)
170715	11.310
170716	11.630
AMS118-1	14.930
AMS108	15.180
AMS109	16.470

Carton weight check

Carton weight check

G3 | Total cartons were selected randomly for inspection

2018/09/17



Inspection goods

Inspection goods

G4 Whether there is Carton number

Yes

Write down carton number of all selected cartons:

24,16,31/17,23,9/11,23,30/---/9,14,29

G5 Whether there is Samples Collection

No

#### **ANNEX**

# ANNEX 1 — NEGATIVE OBSERVATIONS The cartons were stacked too high, more than 6 feet / 1.8 meter high. The cartons were placed on the ground directly in warehouse. Glasses of window were broken in the warehouse. Some water was found on the floor in warehouse, but no wet carton was found. The workers did not pay extra attention during handling or re-packing. Inspection room was too small for a smooth inspection. The factory could not provide gloves to inspector when necessary during the inspection. The factory did not provide enough workers to help the inspections.



Report No.: 2018032918272788

Report Date:17 September 2018

Page 41 of 42

☐The inspection room was too dark for a smooth inspection.
☐ The products were not manufactured in this factory (production lines were not found).
No above negative issues observed.

ANNEX 2 — MEASURING AND TESTING EQUIPMENT USED FOR THIS INSPECTION					
Description	Identification	Calibration date	Invalid date	From	
Weight scale	Electronic	N/A	N/A	Factory	
Ruler	N/A	N/A	N/A	Inspector	

#### **VALIDATION TEAM**

Inspected by	Fancy Fan
Inspection date	Sep. 17. 2018
Reviewed by	Misty Chen
Review date	Sep. 17. 2018
Approved by	Mohamed Afilal
Approved date	Sep. 17. 2018





Factory gate





Goods storage

The results reflects our findings at time and place of inspection. This report does not relieve seller/manufacturers from their contractual liabilities or prejudice buyers' right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment, Final approval is required by client before releasing shipment.



Report No.: 2018032918272788

Report Date:17 September 2018

Page 42 of 42



End of this report